


INSTALLATION AND WIRING DIAGRAM

USA

LEDRA SERIES LEDS

LEDRA™ R w/J-box and Driver

ART. NO. 135 735/s	white, 10° lens
135 735/m	white, 30° lens
135 735-1/s	warm white, 10° lens
135 735-1/m	warm white, 30° lens

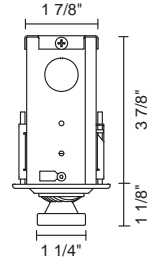

IMPORTANT SAFETY INSTRUCTIONS



1. THIS PRODUCT MUST BE INSTALLED BY A PERSON FAMILIAR WITH THE CONSTRUCTION AND OPERATION OF THE PRODUCT AND THE HAZARDS INVOLVED, IN ACCORDANCE WITH THE LOCAL AND NATIONAL CODE.
2. DRY LOCATIONS ONLY.
3. SUITABLE FOR SUSPENDED CEILING.
4. Turn off power prior to any work on the systems.
5. Warranty is void in case of unauthorized modifications and/ or improper use.

READ ALL OF THESE INSTALLATION INSTRUCTIONS BEFORE INSTALLING THE FIXTURE

Note: the 2" surface mount canopy is designed for a ceiling thickness between 1-1/16" and 3/16".

Step 1
- Drill a 2-1/4" hole in the mounting surface.

Step 2
- Slide the j-box (D) into the mounting surface (make sure the side brackets (C) are not extended outwards). When possible, place support ring (J) over J-box. Tighten the mounting screws (H) to extend the side brackets and hold the j-box in place.
DO NOT overtighten the screws; the side brackets may cut through the mounting surface.

Step 3
- Pull the line voltage wires (A) and ground wire (B) through the back plate (C). Use wire nuts to connect the wires to the black, white, and green wires from the driver. Attach the back plate (C) to the j-box (D) with screws.

Step 4
- Place the magnetic cover-plate (E) over the j-box (D) to complete the installation.

